

Injectronics

Remanufactured Automotive Electronics Components

TECHNICAL BULLETIN

Document number: T0047

For further technical information regarding testing, repairs or to search for New or Remanufactured Automotive electronic products, please visit www.injectronics.com.au, call our office on (+613) 8792 6999, or email sales@injectronics.com.au

Make: Mitsubishi

Model: 3.5L Pajero / Triton

Subject: Engine miss

From 1993 the Mitsubishi Pajero and Triton used a 3.5L twin cam engine (6G74). This engine used 3 ignition coils and the waste spark principle. Injectronics have been sent a number of ECM's for testing with the complaint that one of the coils is not being triggered by the ECM. This stops 2 cylinders from operating. We have found that the ECM test ok and the problem is with valve timing.

The cam angle sensor is mounted near the LH bank camshaft sprocket and the crank angle sensor is mounted near the crankshaft sprocket. If the cam belt is not fitted correctly, then the correlation between the crankshaft and the cam shaft signal will be incorrect and the ECM cannot correctly determine at what time to fire the 3 ignition coils.

T0047.doc

This publication is distributed with the understanding that the authors, editors and publishers are not responsible for the results of any actions or works of whatsoever kind undertaken on the basis of information contained in this publication, nor for any errors or omissions contained herein. The publishers, authors and editors expressly disclaim all and any liability to any person whomsoever whether a purchaser of this publication or not in respect of anything and of the consequences of anything done or omitted to be done by any such persons in reliance, whether whole or partial upon the whole or any part of the contents of this publication. Injectronics Australia Pty Ltd. © Copyright 2001.