

Injectronics

Remanufactured Automotive Electronics Components

TECHNICAL BULLETIN

Document number: T0076

For further technical information regarding testing, repairs or to search for New or Remanufactured Automotive electronic products, please visit www.injectronics.com.au, call our office on (+613) 8792 6999, or email sales@injectronics.com.au


Make: Daewoo

Model: Cielo 1.5L 94-5

Subject: No start

Injectronics has recently had a number of calls on the Daewoo Cielo 1.5L for a no start situation, after further investigation it was found that this was generally occurring after the head gasket had been done on the vehicle.

The problem was traced back to the coolant temp sensor and the distributor, they sit beside each other on the vehicle, both have identically shaped pin plugs, if the plugs are swapped around the vehicle will not start. The easy solution is swap the plugs back around, generally no damage occurs to the engine ECU, if any further problems occur the ECU can be tested by Injectronics.

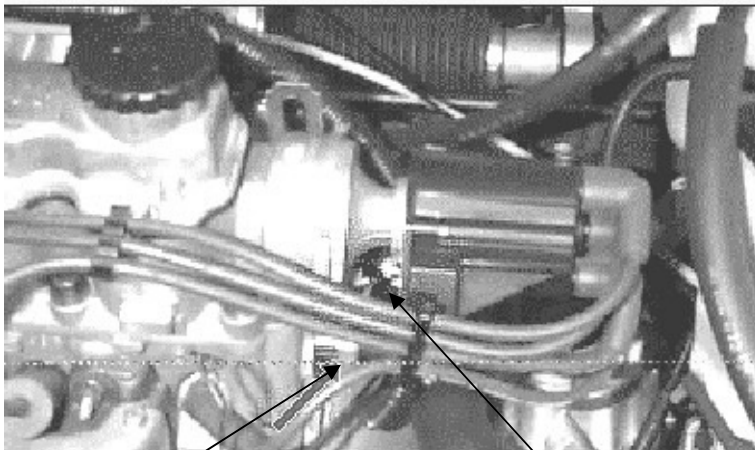

Coolant sensor plug

Distributor plug

T0076.doc

This publication is distributed with the understanding that the authors, editors and publishers are not responsible for the results of any actions or works of whatsoever kind undertaken on the basis of information contained in this publication, nor for any errors or omissions contained herein. The publishers, authors and editors expressly disclaim all and any liability to any person whomsoever whether a purchaser of this publication or not in respect of anything and of the consequences of anything done or omitted to be done by any such persons in reliance, whether whole or partial upon the whole or any part of the contents of this publication. Injectronics Australia Pty Ltd. © Copyright 2001.