

# Injectronics

Remanufactured Automotive Electronics Components

## TECHNICAL BULLETIN

**Document number: T0095**

*For further technical information regarding testing, repairs or to search for New or Remanufactured Automotive electronic products, please visit [www.injectronics.com.au](http://www.injectronics.com.au), call our office on (+613) 8792 6999, or email [sales@injectronics.com.au](mailto:sales@injectronics.com.au)*

**Make: Ford**

**Model: Falcon EF 4.0L**

**Subject: No A/C compressor operation**

**FAULT:**

There is no A/C compressor or radiator fan operation when the A/C switch is activated but the radiator fans operate as per engine temperature requirement.

**TEST:**

Check that the compressor clutch operates via the A/C switch when ignition is switched ON, engine not running (KOEO).

**CAUSE:**

Open circuit in evaporator temperature sensor. ECM pin 30 has 1.5 – 2 volts @ 20 degrees C.  
Evaporator temperature sensor is connected via pins 30 & 91.

**t0095.doc**