

Remanufactured Automotive Electronics Components

TECHNICAL BULLETIN

Document number: T0111

For further technical information regarding testing, repairs or to search for New or Remanufactured

Automotive electronic products, please visit www.injectronics.com.au, call our office on (+613) 8792 6999,

or email sales@injectronics.com.au

Make: Daihatsu

Model: Sirion 2000

Subject: Engine will not start, no spark or injection

Test: No fault codes were evident.

Check for an inductive output signal from the crank angle sensor during crank.

Check engine cranking speed, approx 430 rpm with spark plugs fitted, no ignition or injection control evident.

Remove the spark plugs & recheck engine cranking speed approx, 480 rpm.

Ignition & injection control will be evident on the higher cranking speed.

Cause: The engine had the wrong grade/viscosity of engine oil in the engine resulting in lower than expected cranking speed.

Replace the engine oil with the correct grade/viscosity engine oil.

T0111.doc