

Injectronics

Remanufactured Automotive Electronics Components

TECHNICAL BULLETIN

Document number: T0113

For further technical information regarding testing, repairs or to search for New or Remanufactured Automotive electronic products, please visit www.injectronics.com.au, call our office on (+613) 8792 6999, or email sales@injectronics.com.au

Make: Ford

Model: Falcon BA 4.0L

Subject: No tiptronic function

TEST: Road test vehicle, the automatic transmission will shift normally in drive but there is no tiptronic function. Listen for a buzzing noise from the transmission in Park & Neutral? (Variable pressure solenoid) The quadrant light in instrument cluster always shows the transmission in drive.

PCM has logged a selector range switch fault.

FAULT: There was a broken wire in the harness under ABS module (CAN Network).

The instrument cluster should indicate PRNDL at KOEO.

T0113.doc

This publication is distributed with the understanding that the authors, editors and publishers are not responsible for the results of any actions or works of whatsoever kind undertaken on the basis of information contained in this publication, nor for any errors or omissions contained herein. The publishers, authors and editors expressly disclaim all and any liability to any person whomsoever whether a purchaser of this publication or not in respect of anything and of the consequences of anything done or omitted to be done by any such persons in reliance, whether whole or partial upon the whole or any part of the contents of this publication. Injectronics Australia Pty Ltd. © Copyright 2001.