

Injectronics

Remanufactured Automotive Electronics Components

TECHNICAL BULLETIN

Document number: T0048

For further technical information regarding testing, repairs or to search for New or Remanufactured Automotive electronic products, please visit www.injectronics.com.au, call our office on (+613) 8792 6999, or email sales@injectronics.com.au

Make: Ford

Model: EA / EB

Subject: Distributor engine miss cylinder 5

Injectronics has heard of situations where an incorrect distributor has caused an EA, EB central fuel injection (CFI) vehicle to miss on cylinder number 5.


It has been found that a multipoint (MPI) distributor has been installed to the CFI engine, or the MPI chopper wheel has been installed into a CFI distributor. The distributor housing looks the same and so is the hall sensor plate however the chopper (interrupter) wheel is different on the CFI and MPI engine.

The CFI chopper wheel has evenly spaced gaps, however the MPI has one gap which is larger than the other 5. The chopper wheel of a MPI distributor can be identified by a hole above the larger slot seen from the top of the wheel.


Bosch part number of CFI distributor – 9230 065 604 / 606

Bosch part number of MPI distributor – 9230 065 603 / 605

MPI Rotor

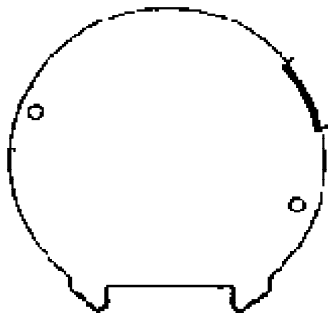

CFI Rotor

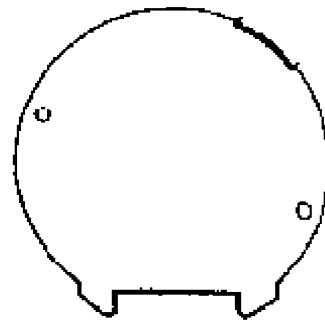

T0048.doc

This publication is distributed with the understanding that the authors, editors and publishers are not responsible for the results of any actions or works of whatsoever kind undertaken on the basis of information contained in this publication, nor for any errors or omissions contained herein. The publishers, authors and editors expressly disclaim all and any liability to any person whomsoever whether a purchaser of this publication or not in respect of anything and of the consequences of anything done or omitted to be done by any such persons in reliance, whether whole or partial upon the whole or any part of the contents of this publication. Injectronics Australia Pty Ltd. © Copyright 2001.