FORD - FALCON EF

Injectronics

TECHNICAL BULLETIN

#T0095

Make: Ford

Model: Falcon EF 4.0L

Subject: No A/C compressor operation

FAULT:

There is no A/C compressor or radiator fan operation when the A/C switch is activated but the radiator fans operate as per engine temperature requirement.

TEST:

Check that the compressor clutch operates via the A/C switch when ignition is switched ON, engine not running (KOEO).

CAUSE:

Open circuit in evaporator temperature sensor. ECM pin 30 has 1.5 – 2 volts @ 20 degrees C.

Evaporator temperature sensor is connected via pins 30 & 91.

injectronics.com.au

This information has been offered with the intent to provide a resource of reliable information; however no warranty (express or implied) is made as to the accuracy or completeness. No liability is assumed by Injectronics for damage or loss resulting from reliance on this information or process.