

*Inj*ectronics

TECHNICAL BULLETIN

HYUNDAI – LANTRA

#T0125

Make: Hyundai

Model: Lantra 1.6L / 1.8L DOHC

Subject: Poor idle quality (surges)

TEST: Engine surges at idle, check fault codes, is AMM code 12 logged? Poor engine performance

FAULT: Incorrectly adjusted or installed camshaft timing belt.

Remove the timing belt top cover, locate & highlight the valve timing indexing marks.

Install a neon timing light to number 1 cylinder, start the engine & observe the valve timing indexing marks, both timing marks should not fluctuate, if so, readjust the timing belt & or replace the timing belt tensioner using the manufacturers recommended procedure