

Injectronics

TECHNICAL BULLETIN

MITSUBISHI – MAGNA TE

#T0132

Make: Mitsubishi

Model: Magna TE 3.0L

Subject: Engine surges & lacks power

TEST: Road test vehicle, the engine surges and lacks power for no apparent reason. When acceleration from a near stop i.e.; slowing down to turn a corner. Stop the vehicle, cycle the ignition switch the vehicle would perform normally.

There were no fault codes present & the fuel pressure & flow were within specifications.

FAULT: The oxygen sensor was faulty causing the engine to run lean. Disconnect the O2 sensor to confirm the fault, the engine would perform normally with the O2 sensor disconnected.